

# G360 ROTARY SYSTEM



For optimum results use correct machine speeds, minimal product, apply minimal pressure and clean the pads regularly, especially the G Mop Super High Cut Pad, with a G Plus Spurring Brush.  
\* P2000 is suggested for low energy clear coats (air dry).

## HIGH CUT

To remove P1500 or finer\* sanding marks

~~P3000~~

**NO P3000  
SANDING REQUIRED!**




**G360 Super Fast Compound**  
1 kg **SFC101**  
(780727**00162**)


**G Mop Super High Cut Pad**  
150 mm **GMC650**  
(780727**00153**)

### ON ALL COLOURS

- Eliminates P1500 sanding marks from all conventional clear coats (low bake)
- Prepares for **MEDIUM CUT** polishing

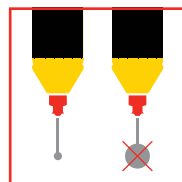

Apply product, using a **small amount**

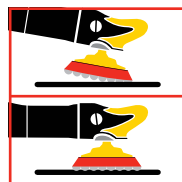

Using minimal pressure, start polishing at **1500rpm** at a slight angle, ending at **900rpm** keeping the pad flat



Wipe clean with a G Plus Finishing Cloth

## MEDIUM CUT

To remove process marks and medium defects (such as swirls and light scuffs)



**G360 Super Fast Compound**  
1 kg **SFC101**  
(780727**00162**)


**G Mop Angled Yellow Compounding Foam**  
150 mm **GMC622**  
(780727**69182**)

### ON LIGHT COLOURS


- Rapidly eliminates visible swirls and holograms
- Leaves an excellent gloss finish

### ON DARK COLOURS

- Rapidly eliminates heavy swirls and holograms
- Prepares for **FINE CUT** polishing

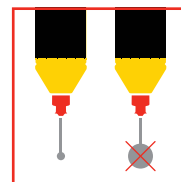

Apply product, using a **small amount**

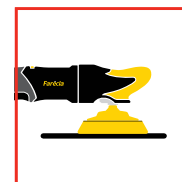

Polish at **900 - 1300rpm**, keeping the pad flat



Wipe clean with a G Plus Finishing Cloth

## FINE CUT

To remove fine defects (such as holograms and light swirls) and enhance gloss levels



**G360 Super Fast Finish**  
1 L **SFF101**  
(780727**00138**)


**G Mop Angled Black Finishing Foam**  
150 mm **GMF622**  
(780727**69185**)

### ON LIGHT COLOURS


- Further enhances gloss levels if desired

### ON DARK COLOURS

- Rapidly eliminates light swirls and holograms
- Leaves an enhanced deep gloss finish

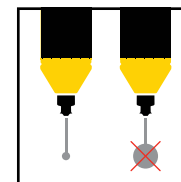

Apply product, using a **small amount**

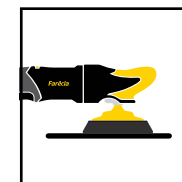

Polish at **800 - 1100rpm**, keeping the pad flat



Wipe clean with a G Plus Finishing Cloth

## FINAL CLEANING AND PROTECTION

To remove residue and contaminants while adding shine and protection




**Clean and Protect**  
1 L **CAP101**  
(780727**66935**)

**G Plus Finishing Cloth**  
400 mm x 400 mm  
3 cloths **FC-3**  
(780727**00136**)

### NO SILICONES, NO VOC

- Cleans away residue, dust, fingerprints and other contaminants
- Use on paint, glass, trims, rubber and many other surfaces
- Leaves a friction-free, high gloss finish
- Leaves a breathable, water-resistant film

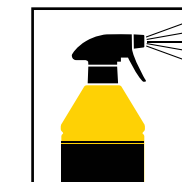

Spray a light mist onto the surface



Wipe clean with a G Plus Finishing Cloth



Use a clean, dry G Plus Finishing Cloth to buff to a shine



### G Plus Rotary Polishing Machine range

- G Plus Electric Rotary Polishing Machine (EU plug) **GPT002** (780727**00159**)
- G Plus Electric Rotary Polishing Machine (UK plug) **GPT003** (780727**73610**)
- G Plus Cordless Rotary Polishing Machine (tool only) **GPT050** (780727**73698**)
- G Plus Rechargeable Li-Ion Battery **GPT150** (780727**73702**)
- G Plus 18V Twin Bay Battery Charger **GPT151** (780727**73704**)



For best results and longer pad life:

### G Mop Flexible Back Plate

- 14 mm thread **GMB146** (780727**00148**)
- 5/8" thread **GMB586** (780727**15924**)
- 16 mm thread **GMB166** (780727**15925**)



Keep pads clean using a:  
**G Plus Spurring Brush**  
**GPS001** (780727**73569**)



FareclaProductsLTD

#FARECLA G360

+44 (0) 1920 465 041 | enquiries@farecla.com | www.Farecla.com

SEE THE  
G360 SYSTEM  
IN ACTION



**Farécla** | SURFACE FINISHING SPECIALISTS